

# Technical Bulletin

HAMMOND ORGAN

"music's most glorious voice"

January 12, 1967  
NO. MODELS

TO ALL MAINTENANCE ENGINEERS - CHANGES


SUBJECT: SWITCHING TRANSIENT ("E" SERIES)  
IMPROVED BASS RESPONSE (H-100)

46 E-100, 200, 300  
H-100

To relieve the above condition in the "Vibrato On" switches on "E" series instruments, we recommend rerouting the Yellow and Green wires going to the preamplifier, as indicated in the diagram below. To complete the circuit it will be necessary to add condensers; C-401 and C-402, .039 MFD/100 volts as indicated in the diagram below.

The drawing on the left represents the original wiring method, while the drawing on the right represents the above changes.

NOTE: (H-100) To improve Bass response, substitute .082 MFD capacitors for C-650 and C-651. These capacitors are now .15 MFD, and are located on the Expression Control.

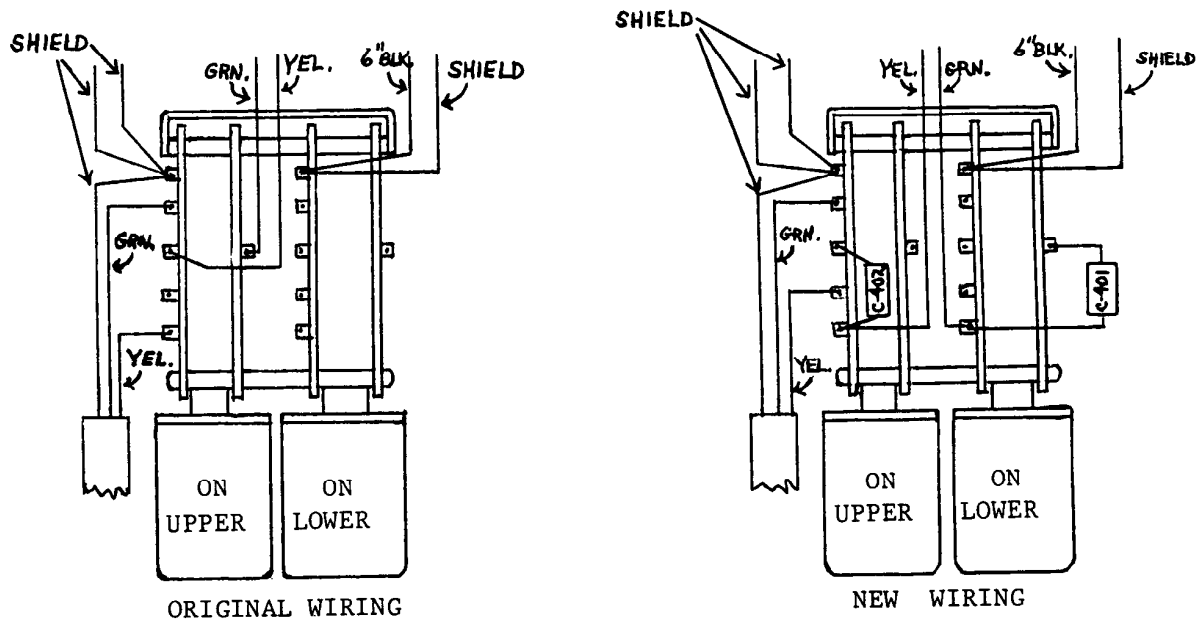

NOTE: This bulletin is a confidential letter to the Hammond dealer organization and is not for general distribution.  
HAMMOND ORGAN COMPANY, 4200 W. DIVERSEY AVE., CHICAGO, ILL., 60639